

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
1-Double Parking Space: South Side of the Field. [One double handicap parking space design to become one double handicap parking space design including a Van Accessible handicap parking space.]	Parking space has 18' minimum length. Parking space has minimum 18' x 5' wide access aisle between stalls (8' min. if one is Van Accessible). 2% max. surface slope in any direction within parking space & access aisle. HC parking sign with symbol of accessibility is installed at each space. The words "NO PARKING" are painted in white on the ground within each access aisle. "NO PARKING" letters are a minimum of 12" high and visible to traffic enforcement officials.	Major asphalt overlay (avg. 2" to 6"). Fix the existing concrete swale within the handicap parking space(s). Install striping and surface identification for double accessible parking stall. Install post-mounted signage at each stall. Install post-mounted Van-Accessible signage at west most stall.	1	2012 - 2013	\$10,587.31		
2-Walks and Sidewalks: South Side of the Field. [From the double handicap parking space design in Item #1 to both ends into the field and the telephone.]	5% max. surface slope in direction of travel. 2% max. cross slope. 48" minimum width of walkway.	Replace existing sidewalk.	1	2012 - 2013	\$3,062.56		
3-Telephones: South Side of the Field. [See Item #2 for additional recommendations.]	30" x 48" min. clear floor space. Forward Reach Phones - 48" max. height of operable part. Volume controls are provided on one phone in each bank and on 25% of all other public phones. Telephones with volume controls are hearing aid compatible (blue grommet) and shall have hearing aid compatible signage.	Lower one existing telephone cabinet or contact the phone company to make the modification. Install signage for volume control or text telephone or contact the phone company to make the modification. Replace telephone with one that has volume control or contact the phone company to make the modification.	4	2012 - 2013	\$1,615.51		
4-Hazards: One Tree at the Eastern Most Entrance to the Field.	80" min. vertical clearance for overhead obstructions. Sidewalks are clear of hazards. If vertical clearance is less than 80", a barrier must be provided.	Cut tree branches away from pathway.	1	2012 - 2013	\$76.57		
5-Doors: East Entrance at the South Side of the Field. [One gate remains open during all events.]	32" min. clear width of doorway. Door hardware is operable with a single effort (lever type, panic bar or push pull type). Bottom 10" of door has a smooth uninterrupted surface. The international symbol of accessibility is posted at all primary entrances.	Replace gate and frame. Replace gate hardware with compliant hardware. Install kick-plate to bottom of gate. Post a sign/decal displaying the "International Symbol of Accessibility" at the primary entrance.	2	2012 - 2013	\$2,335.20		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
6-Clear Space at Doors: East Entrance at the South Side of the Field. [One gate remains open during all events.]	Minimum strike side clearance on PULL side of door: 24" exterior doors.	Install level exterior door landing.	2	2012 - 2013	\$153.13		
7-Walks and Sidewalks: Between the Entrances to the Field at the North Side of the Restrooms. [From the Men's restroom to the Women's restroom.]	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2). 2% max. cross slope.	Replace existing sidewalk between the restrooms.	1	2012 - 2013	\$2,143.80		
8-Doors: West Entrance at the South Side of the Field. [Gate remains open during all events.]	Door hardware is operable with a single effort (lever type, panic bar or push pull type). Bottom 10" of door has a smooth uninterrupted surface. The international symbol of accessibility is posted at all primary entrances.	Replace gate hardware with compliant hardware. Install kick-plate to bottom of gate. Post a sign/decal displaying the "International Symbol of Accessibility" at the primary entrance.	2	2012 - 2013	\$375.16		
9-Clear Space at Doors: West Entrance at the South Side of the Field. [Gate remains open during all events.]	Floor or landing is level and clear (2% max. slope).	Install level exterior door landing.	2	2012 - 2013	\$2,296.93		
10-Hazards: West Entrance at the South Side of the Field. [Gate remains open during all events.]	80" min. vertical clearance for overhead obstructions. Sidewalks are clear of hazards. If vertical clearance is less than 80", a barrier must be provided.	Remove the overhang at the South side of the shed.	1	2012 - 2013	\$2,134.69		
11-Walks and Sidewalks: By the Bleachers.	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2).	Minor asphalt overlay (1" avg. or less) to access the bleachers.	2	2012 - 2013	\$5,728.08		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
12-Water Fountains (Drinking): At the South Side of the Field. [One water fountain.]	18" - 19" depth of fountain. 27" high x 8" deep clear knee space under fountain. 9" high x 17" deep toe clearance. Lever or push bar control is located 6" max. from front edge. Bubbler outlet is 36" max. from floor. 4" min. height of stream. Two fountains are provided, one that is wheelchair accessible and one at normal height for those persons having difficulty bending or stooping.	Install new HI-LO drinking fountain. Remove the water fountain.	2	2012 - 2013	\$7,596.65		
13-Doors: Women's Restroom. [Gate remains open during all events.]	32" min. clear width of doorway. Door hardware is operable with a single effort (lever type, panic bar or push pull type). Bottom 10" of door has a smooth uninterrupted surface.	Replace door(s) and frame (stud wall). Install kick-plate to bottom of door. Replace door hardware with compliant hardware.	2	2012 - 2013	\$2,319.88		
14-Clear Space at Doors: Women's Restroom. [Gate remains open during all events.]			2	2012 - 2013	\$0.00		
15-Identification Symbols, Restrooms: Women's Restroom.	Women's - 12" diameter circle 1/4" thick. Wall mounted signage: 6" min. symbol of accessibility is mounted on wall adjacent to latch side of door.	Install door-mounted sign on single door. Install wall-mounted sign at single entrance.	3	2012 - 2013	\$229.69		
16-Single Accommodation Toilet: Women's Restroom. [See Improvement #13 for additional recommendations.]	Space for 30" x 48" wheelchair to enter and permit door to close. Privacy lock, push button, lever release. 28" minimum between the water closet and any fixture or a minimum of 32" clear space to opposite wall. 18" between centerline of water closet and side wall. 42" min. clearance between centerline of water closet and opposite wall. 17" - 19" to top of seat.	Remove toilet partition. Relocate water closet. Relocate toilet paper dispenser. Provide a toilet seat to comply with the maximum height requirement of 17" - 19".	2	2012 - 2013	\$1,725.54		
17-Toilet Grab Bars: Women's Restroom.	1-1/4" to 1-1/2" diameter of bar. Side bar has 42" min. length. Back bar has 36" min. length.	Install two grab bars.	3	2012 - 2013	\$459.38		
18-Lavatories: Women's Restroom.	27" high x 8" deep knee clearance under front lip. Drain and piping is insulated or configured to prevent contact. 5 lb. max. force required to operate controls.	Raise existing lavatory. Insulate pipes under lavatory. Reduce force needed to operate faucet controls (5 lb. maximum).	3	2012 - 2013	\$1,722.69		
19-Accessories: Women's Restroom.	40" maximum height to bottom of reflective surface of mirror. 40" max. height to all other fixtures.	Relocate mirror. Relocate the hand dryer.	3	2012 - 2013	\$153.13		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
20-Doors: Men's Restroom. [Gate remains open during all events.]	Door hardware is operable with a single effort (lever type, panic bar or push pull type). Bottom 10" of door has a smooth uninterrupted surface.		2	2012 - 2013	\$0.00		
21-Clear Space at Doors: Men's Restroom. [Gate remains open during all events.]			2	2012 - 2013	\$0.00		
22-Identification Symbols, Restrooms: Men's Restroom.	Door mounted signage: Men's - Equilateral triangle with 12" sides, 1/4" thick with the vertex pointing up. Wall mounted signage: 6" min. symbol of accessibility is mounted on wall adjacent to latch side of door.	Install door-mounted sign on single door. Install wall-mounted sign at single entrance.	3	2012 - 2013	\$229.69		
23-Multiple Accommodation Toilets: Men's Restroom. [No stall door provided.]	60" min. diameter turning circle clear of objects from floor height to 27" in room. 44" min. clear path provided throughout facility. 34" minimum opening at side. 60" minimum clear space is provided in front of water closet when compartment door is at side of stall. 60" min. width of stall. 18" between center of water closet and side wall. 32" min. from side of water closet to opposite wall. 42" min. from centerline of water closet to opposite wall. 17" - 19" to top of seat. Flush valve is on wide side. Front of toilet paper dispenser is within 36" of the back wall.	Provide major renovation (including moving plumbing locations and walls).	2	2012 - 2013	\$35,578.12		
24-Toilet Grab Bars: Men's Restroom.	1-1/4" to 1-1/2" diameter of bar. Side bar has 42" min. length. Back bar has 36" min. length.	Install two grab bars.	3	2012 - 2013	\$459.38		
25-Lavatories: Men's Restroom. [See Improvement #23 for additional recommendations.]	18" min. from center of fixture to side wall. 27" high x 8" deep knee clearance under front lip. Drain and piping is insulated or configured to prevent contact. 5 lb. max. force required to operate controls.	Relocate existing lavatory. Insulate pipes under lavatory. Reduce force needed to operate faucet controls (5 lb. maximum).	3	2012 - 2013	\$1,554.19		
26-Urinals: Men's Restroom.	17" max. rim height.	Relocate urinal.	3	2012 - 2013	\$1,531.28		
27-Accessories: Men's Restroom.	40" max. height to all other fixtures.	Relocate the hand dryer.	3	2012 - 2013	\$76.57		
28-Doors: Gates at the West Entrance to the Field. [Gates are always open during events.]	Bottom 10" of door has a smooth uninterrupted surface.		2	2012 - 2013	\$0.00		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
29-Clear Space at Doors: Gates at the West Entrance to the Field. [Gates are always open during events.]	Floor or landing is level and clear (2% max. slope).	Requires engineering/architectural evaluation. Provide accessible pedestrian ramp with compliant hand rails.	1	2012 - 2013	\$7,115.62		
<b>Report Year 2011 - 2012 Total</b>					\$91,260.75		
<b>Entire Report Total</b>					\$91,260.75		