

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
1-Walks and Sidewalks: Asphalt Path of Travel Along Parkview Lane. [Asphalt path of travel from the East to the West sides of the park.]	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2) (Very rough throughout). 5% max. surface slope in direction of travel (7.8%+ or - at the Western terminus). 2% max. cross slope [0.4% - 9.6% throughout (4% average).]	Major asphalt overlay (avg. 2" to 6").	1	2014 - 2015	\$20,663.78		
2-Seating, Tables and Work Surfaces: Two Tables at the West End of the Park.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Install new sidewalk. Provide a minimum of one accessible table. Provide access to a minimum of one table.	2	2014 - 2015	\$691.07		
3-Curb Cut Ramp: One Curb Cut Ramp Just North of the Play Area.	8.33% max. surface slope. 10% max. side slope. 2% max. slope of top landing. Transition to gutter, walks, streets is flush and free of abrupt changes. 5% max. sloped surface for 48" length from bottom terminus of the ramp. 12" grooved border on level surface along top and sides of ramp. Truncated domes are provided on ramps with slopes between 5% and 6.67%.	Major asphalt overlay (avg. 2" to 6"). Remove the existing curb-cut ramp. Remove and Replace existing concrete curb. Remove the existing curb cut ramp and replace with additional asphalt and curb to make a continuous sidewalk.	1	2014 - 2015	\$2,388.52		
4-Seating, Tables and Work Surfaces: One Table at the East End of the Park.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Provide a minimum of one accessible table. Install new sidewalk. Provide access to the table.	2	2014 - 2015	\$368.30		
5-Walks and Sidewalks: Sidewalk at the North Side of the Play Area.	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2) (asphalt / concrete transition). 5% max. surface slope in direction of travel (9%+ or - for 7' section at the Northeast corner of play area). 2% max. cross slope (2.6% - 9% at the East and West ends of the play area). 48" minimum width of walkway (35-3/4" at the East and West ends of the play area).	Replace existing sidewalk. Remove existing concrete curb. Remove a 48" section of curb to access play area.	1	2014 - 2015	\$1,653.79		
6-Hazards: One Tree at the Northeast Corner of the Play Area.	80" min. vertical clearance for overhead obstructions. Sidewalks are clear of hazards. If vertical clearance is less than 80", a barrier must be provided.	Cut tree branches away from pathway.	1	2014 - 2015	\$76.57		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
7-Water Fountains (Drinking): One Water Fountain at the North Side of the Play Area.	32" min. wide and 18" min. deep alcove provided. 18" - 19" depth of fountain. 27" high x 8" deep clear knee space under fountain. 9" high x 17" deep toe clearance. Lever or push bar control is located 6" max. from front edge. Bubbler outlet is 36" max. from floor. Stream of bubbler is parallel to front edge. Two fountains are provided, one that is wheelchair accessible and one at normal height for those persons having difficulty bending or stooping.	Remove the water fountain. Install new HI-LO drinking fountain.	2	2014 - 2015	\$7,596.65		
Report Year 2015 - 2016 Total					\$33,438.68		
Entire Report Total					\$33,438.68		