

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
1-Walks and Sidewalks: Asphalt Path of Travel at the West Side of the Park Along Brookhill Road.	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2). (Rough / broken asphalt / pot holes.) 2% max. cross slope (0.6% - 5.8% (3.5% average).	Major asphalt overlay (avg. 2" to 6").	2	2014 - 2015	\$27,551.70		
2-Seating, Tables and Work Surfaces: Four Tables at the East Side of 712 and 718 Brookhill Road.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Install new sidewalk. Provide a minimum of one accessible table. Provide access to the table.	2	2014 - 2015	\$870.39		
3-Walks and Sidewalks: At the Northeast Section of the Park at Turtle Creek Drive. [From 909 Turtle Creek Drive to the Northeast terminus.]			2	2014 - 2015	\$0.00		
4-Seating, Tables and Work Surfaces: Directly Southwest of 807 Turtle Creek Drive.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Provide a minimum of one accessible table.	3	2014 - 2015	\$153.13		
5-Walks and Sidewalks: At the East Side of the Park. [From the West side of 910 Turtle Creek Drive to the Southern terminus.]	2% max. cross slope (0.6% - 6.8% (3% average).	Minor asphalt overlay (1" avg. or less). Major asphalt overlay (avg. 2" to 6").	1	2014 - 2015	\$16,052.85		
6-Seating, Tables and Work Surfaces: Two Tables by 910 Turtle Creek Drive. Access to the tables has surface slopes of 7.8%+ or - for 5'-9" section.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Provide a minimum of one accessible table. Install new sidewalk. Either provide handrails or pour additional concrete under 5% directional slope to avoid ramp requirements.	2	2014 - 2015	\$368.30		

<i>Item/Location</i>	<i>Barrier (noted feature, item or area does not meet the new construction criteria detailed below)</i>	<i>Action</i>	<i>Priority</i>	<i>Target Date</i>	<i>Estimated Cost</i>	<i>Interim Solution</i>	<i>Action Completion Date</i>
7-Seating, Tables and Work Surfaces: Two Tables at the Southeast Terminus of the Sidewalk in Item #5. [Two tables located by 1515 Trinity Court. Provide a minimum of one accessible table.	30" x 48" min. clear floor space is provided. 27" high, 30" wide and 19" deep knee clearance provided.	Provide a minimum of one accessible table. Install new sidewalk. Either provide handrails at the 48" section of concrete accessing the tables (6% directional slope) or provide an additional path of travel at less than 5% to avoid additional ramp requirements.	2	2014 - 2015	\$368.30		
8-Walks and Sidewalks: Directly Across from 802 Brookhill Road. [Access to shuffleboard area and water fountain.]	Continuous common surface is not interrupted by steps or abrupt changes in level (less than 1/4" vertical or 1/2" beveled at 1:2). (None to shuffleboard area). 5% max. surface slope in direction of travel (existing asphalt is up to 12%+ or -).	Major asphalt overlay (avg. 2" to 6").	2	2014 - 2015	\$1,033.19		
9-Water Fountains (Drinking): One Water Fountain Directly Across from 802 Brookhill Road.	32" min. wide and 18" min. deep alcove provided. 18" - 19" depth of fountain. 27" high x 8" deep clear knee space under fountain. 9" high x 17" deep toe clearance. Bubbler outlet is 36" max. from floor. Stream of bubbler is parallel to front edge. 4" min. height of stream. Two fountains are provided, one that is wheelchair accessible and one at normal height for those persons having difficulty bending or stooping.	Remove the water fountain. Install new HI-LO drinking fountain.	2	2014 - 2015	\$7,596.65		
Report Year 2015 - 2016 Total					\$53,994.51		
Entire Report Total					\$53,994.51		